



Triumph

April, 1975

SUBJECT:

ELIMINATION OF FACIA SQUEAKS

MODELS:

TR7

Squeaks emanating from the instrument cluster area on the TR7 can, in most cases, be eliminated by adopting the following procedure.

1. Remove the speaker grille.
2. Remove the facia instrument cowl. See Operation 76.46.17 in the TR7 Workshop Manual. This will reveal the instrument cluster attachment screws.
3. Slacken the two upper instrument cluster attachment screws (Item A). Slacken off the three attachment screws on the upper edge of the instrument lens (Item B). Grip the upper edge of the instrument cluster firmly and pull the entire assembly towards you. Holding the instrument cluster in this position, tighten the three screws securing the lens (Item B) and the two upper attachment screws (Item A).
4. Replace the facia instrument cowl and speaker grille.



J.P.