

ITEM T80/024

SUBJECT: LOW COOLANT LEVEL INDICATOR SYSTEM

MODELS: TR7, TR8

Current TR7 and TR8 vehicles incorporate a low coolant level warning system consisting of a sensor unit, part number C43222, mounted on the cooling system expansion tank and a signal transmitter unit, existing part number RKC 4149, which is a grey colored cylindrical unit mounted above the hood release mechanism. The signal transmitter operates an instrument panel warning light indicating low coolant level in the expansion tank.

TESTING

- A) Switch on ignition. The warning light should stay on approximately 8 seconds.
- B) Leave ignition on, disconnect lead from expansion tank simulating a low coolant condition. The warning light should come on after approximately 10 seconds . . . If the light does not come on, replace the signal transmitter unit with a new unit, part number RKC 5259K colored black.

It is essential to carry out this check and replacement of the unit, if necessary, at PDI or 1,000 mile service or the first opportunity when a vehicle is at the dealership for service.

Warranty claims should be submitted on the standard warranty claim form (SER 6) quoting Service Ref B469 in the comment box No. 20.

Repair time allowance of 0.05 hours is based on the fact that the vehicle will already be in the service shop for service work.

Affected VIN range: 200001 to 211440

400001 to 400524